Legal information

Qualified Personnel

This function must only be handled by qualified personnel whose specialization matches the requirements. A qualified person is someone with relevant experience and the ability to identify hazards and risks associated with the operation. Improper handling by unqualified individuals can lead to operational failures and safety risks.

Disclaimer of Liability

We have thoroughly reviewed the contents of this publication to ensure that it aligns with the described hardware and software. However, as some variations may occur, we cannot guarantee complete consistency. The information in this publication is regularly reviewed, and any necessary updates or corrections will be included in future editions.

Proper use of Halow-Tech products

Products should only be utilized for the specific applications outlined in the accompanying catalog and related technical documents. If incorporating products or components from other manufacturers, they must be either recommended or authorized by the relevant company. To ensure safe and trouble-free operation, proper handling during transport, storage, installation, assembly, commissioning, operation, and maintenance is essential. It is important to adhere to the permissible environmental conditions and to follow the guidelines provided in the associated documentation.

HydroXForce

Master Position, Speed and Force Control



Contents

droXForce	
Description	
Block diagram	
Inputs	
Outputs	
FAQ	
Examples	
Setting the position control and feedforward parameters	
Setting the force control and feedforward parameters	

Description

This function block has been developed to facilitate position and force control of different hydraulic axes, including:

- · Single acting cylinder
- · Plunger cylinder
- · Double acting cylinder
- · Double acting double rod cylinder

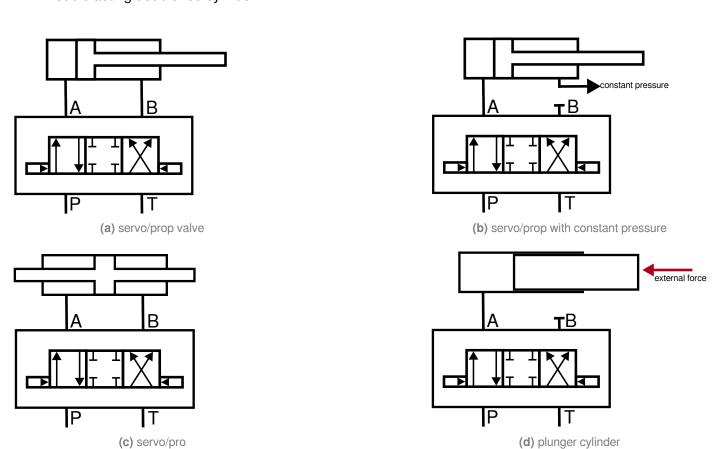


Figure 1: Position and force control for the hydraulic setup shown



The HydroXForce PLC functionblock is an advanced and robust controller designed for the precise management of position and force within hydraulic axes. This function block is engineered to support a wide range of hydraulic cylinders, including single-acting, plunger, double-acting, and double-acting double rod cylinders, seamlessly integrating with linear servo or proportional valves. With its versatile input parameters, the HydroXForce block can operate in either position or force control mode.

The internal trajectory generator enables the controller to utilize not only the closed-loop algorithm but also the open-loop control algorithm simultaneously. This integration allows for rapid, precise, and stable adjustments in position and force control, enhancing the performance and reliability of your hydraulic system. Users can specify parameters such as target position, velocity, acceleration, jerk for axis motion, and target force, force rate, and force acceleration for force control, tailoring the system's response to meet specific application requirements.

Ease of parameterization and commissioning is a key advantage of the HydroXForce block, making it accessible for users to implement and operate. Furthermore, the block provides valuable monitoring outputs, such as position, velocity, and acceleration trajectories, along with a busy signal to indicate active movements. These outputs are crucial for comprehensive system diagnostics and streamline troubleshooting processes during operation.

The diagram illustrates how the HydroXForce function integrates into the overall control system, highlighting its role in achieving precise and reliable position control of the cylinder.

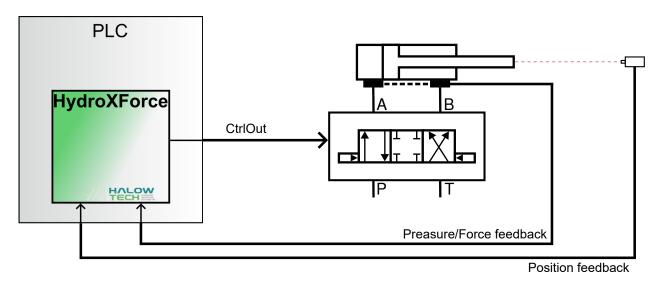


Figure 2: Integration of the function into the overall control system.

Compatible with various PLC platforms like Siemens S7, Siemens TIA Portal, Rockwell Studio AIO, Rockwell RSLogix 5000, Rexroth IndraWorks, B&R Automation Studio, and Beckhoff TwinCAT, FlexiMotion provides the same high performance on any platform.


Needed PLC Functions¹

Mainfunction:	HydPosControl	HaTe_HydPosControlV1a
Subfunction:	SubFunktion1	HaTe_SubFunktion1V3c

¹ In addition to the main function, various subfunctions may be required. These need to be imported into the PLC program as well. If you are already using other functions from Halow-Tech that utilize the same subfunction, it does not need to be imported again.



Block diagram

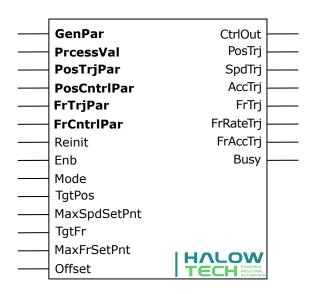

Inputs

GenPar		
	SampleTime	<real></real>
	MaxOut	<real></real>
	MinOut	<real></real>

GenPar → SampleTime - Calling frequency of the controler, <REAL>

The sample time, in second, of the cyclic interrupt task of the plc at which the function is running. A higher sampling frequency allows for more precise control.

GenPar → **MaxOut** - **Maximum Output**, <**REAL**>

Is used to define the upper limit of the $\it CtrlOut$ to a specific value. We recommend to set this limit at 100. This setting essentially represents the highest level of opening for the servo or proportional valve, expressed as a percentage in one direction

GenPar → MinOut - Minimum Output, <REAL>

Is used to define the lower limit of the CtrlOut to a specific value. We recommend to set this limit at -100. This setting essentially represents the highest level of opening for the servo or proportional valve, expressed as a percentage in another direction.

Recommendation: When using a linear servo or proportional valve, it's advised to restrict the control signal to a range between -100 and 100. This range signifies the valve's opening percentage in either direction. Subsequently, these percentage values must be translated to the valve's physical input, which might be represented in current or voltage terms. In figure 3 and 4 are common mappings from output to valve input current shown.



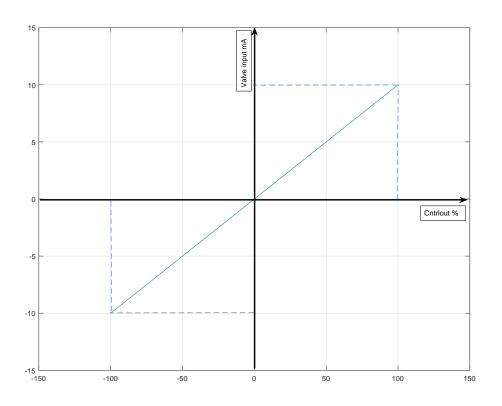


Figure 3: CtrlOut against valve input -10 mA to 10 mA

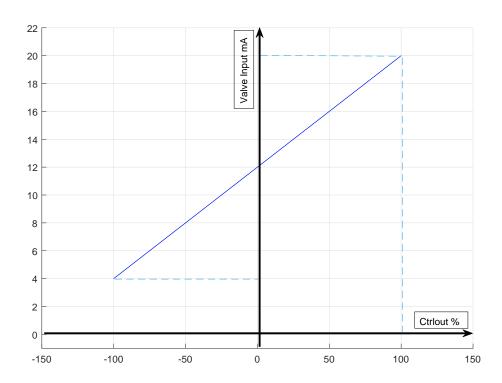


Figure 4: CtrlOut against valve input 4mA to 20mA



PrcessVal		
	ActPos	<real></real>
	ActFr	<real></real>
	ActPr	<real></real>
	HighPr	<real></real>
	LowPr	<real></real>

$PrcessVal \rightarrow ActPos - Cylinder Actual Position, < REAL>$

The input represents the current measured position of the hydraulic cylinder. It is used in the error signal calculation of the internal controller. It should be provided in the same unit as *TgtPos*.

$\textbf{PrcessVal} \rightarrow \textbf{ActFr - Cylinder Actual Force, <} \textbf{REAL>}$

The *ActFr* input is designated for the measured force of the hydraulic axis. It is imperative that the force is measured and inputted in the same unit as the *TgtFr* input. This function block uses the force value for both monitoring and controlling the force exerted by the hydraulic axis.

The measured force value provided to *ActFr* must be sampled at a rate at least as fast as the cycle time of the Cycle Interrupt Task in which the function block operates. This requirement is critical for real-time force control and monitoring.

$PrcessVal \rightarrow ActPr$ - Actual pressure, <REAL>

Actual Pressure value measured in bar on the piston side of the hydraulic cylinder.

PrcessVal → HighPr - High Pressure Line Value, <REAL>

Input the high-pressure line value of the valve in [bar]. This is not a measured value but a fixed constant.

$PrcessVal \rightarrow LowPr$ - Low Pressure Line Value, <REAL>

Input the Low-pressure line value of the valve in [bar]. This is not a measured value but a fixed constant.

PosTrjPar		
	MaxAccSetPnt	<real></real>
	JerkSetPnt	<real></real>

PosTrjPar → MaxAccSetPnt - Maximum Acceleration Setpoint, <REAL>

This input determines the maximum allowable rate of change in velocity for the position trajectory. It is measured in the same unit as *TgtPos* per second squared. This parameter needs to be customized based on the specific system requirements. *MaxAccSetPnt* plays a critical role in regulating the acceleration of the hydraulic cylinder as it follows the trajectory towards the target position.

$\textbf{PosTrjPar} \rightarrow \textbf{JerkSetPnt} \ \textbf{-} \ \textbf{Maximum Jerk Setpoint}, \textbf{<REAL>}$

JerkSetPnt controls the abruptness or smoothness of motion by regulating the rate of change of acceleration. It is measured in the same unit as *TgtPos* per second cubed. Adjusting *JerkSetPnt* allows users to customize the motion profile according to their desired level of abruptness or smoothness. For example, if the maximum acceleration needs to be achieved within half a second, the *JerkSetPnt* value should be set to double the maximum acceleration value. See figure 5.



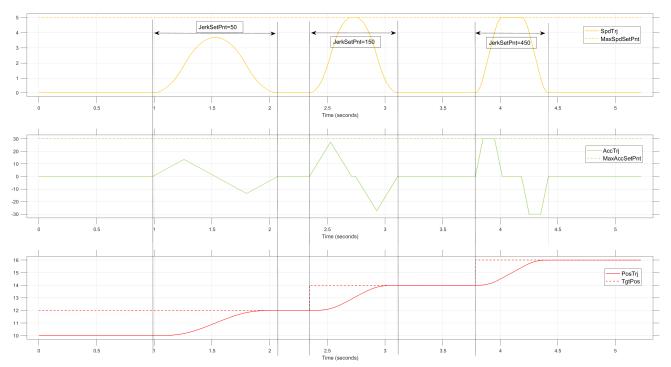


Figure 5: General behavior of the input JerkSetPnt

PosCntrlPar		
	KpPos	<real></real>
	МахКрАтр	<real></real>
	KiPos	<real></real>
	ModeIntCntrl	<bool></bool>
	GainFwdSpdCtrl	<real></real>
	GainBwdSpdCtrl	<real></real>

$PosCntrlPar \rightarrow KpPos - Controller P-Factor, < REAL >$

It represents the amplification factor of the P-controller within the position controller. A higher *KpPos* value can enhance control accuracy. However, caution is advised: setting the *KpPos* value excessively high may render the closed-loop system unstable. For optimal results and to maintain system stability, it's recommended to initiate with a modest *KpPos* value and incrementally adjust upwards to achieve the desired precision. See example 1 for optimal adjustment.

$PosCntrlPar \rightarrow MaxKpAmp$ - Maximum Kp Amplification, <REAL>

It relates to the P-controller (Position and Force controller) within the function block, which is capable of dynamically altering the constant *KpPos* and *KpFr* factor. This adjustment ensures that the hydraulic cylinder exhibits consistent control behavior regardless of the load it bears. The dynamic value of the *KpPos* factor is calculated based on the pressure on the piston side of the cylinder. If the cylinder lacks a pressure sensor, the controller operates with a constant Kp value. Through the *MaxKpAmp* input, users can set the upper limit of the amplification for this constant Kp value. We recommend setting it between 4 and 5.

Important: If the hydraulic cylinder's pressure is not being measured, enter a default value of -1 in the *ActPr* input. This action will effectively deactivate the pressure-dependent dynamic calculation of Kp.

7



$\textbf{PosCntrlPar} \rightarrow \textbf{KiPos} \ \textbf{-} \ \textbf{Controller I-Factor}, \textbf{<} \ \textbf{REAL>}$

KiPos stands for the amplification factor of the I-controller within the position controller. A *KiPos* value set to zero effectively deactivates the I-controller. While a higher *KiPos* value results in swifter error integration, enhancing overall accuracy, it can also introduce increased oscillations in the closed-loop system. For best performance, it's advisable to commence with a low *KiPos* value and gradually increase it until the desired accuracy level is reached, balancing precision with system stability. See example 1 for optimal adjustment.

$\textbf{PosCntrIPar} \rightarrow \textbf{ModeIntCntrI} \ \textbf{-} \ \textbf{Mode Selection for internal Integral Controller}, \textbf{-} \ \textbf{BOOL} \textbf{>}$

This input determines the behavior of the I-Controller. When set to False, the I-Controller remains continuously active. If set to True, the I-Controller operates only in the steady state, deactivating during the hydraulic axis movement. We advise setting this input to true, as allowing the I-Controller to function solely in the steady state often provides superior stability and accuracy for hydraulic axes. This approach typically minimizes, if not eliminates, significant overshoots and, by enabling an increase in the *Ki* factor, greatly enhances accuracy.

PosCntrlPar → GainFwdSpdCtrl - Positive Speed Feedforward, <REAL>

GainFwdSpdCtrl is a system parameter that adds a constant value for positive velocities to the control signal, improving trajectory tracking. It reduces the error signal and facilitates smoother following of the desired trajectory. The optimal positive feedforward value depends on the hardware and system dynamics, which can be determined through measurement and analysis, as illustrated in example 1.

$\textbf{PosCntrlPar} \rightarrow \textbf{GainBwdSpdCtrl} \ \ \textbf{-} \ \textbf{Negative Speed Feedforward}, \textbf{-} \ \textbf{REAL} \textbf{>}$

GainBwdSpdCtrl is a system parameter that adds a constant value for positive velocities to the control signal, improving trajectory tracking. It reduces the error signal and facilitates smoother following of the desired trajectory. The optimal positive feedforward value depends on the hardware and system dynamics, which can be determined through measurement and analysis, as illustrated in example 1.

FrTrjPar		
	FrMaxAccSetPnt	<real></real>
	FrJerkSetPnt	<real></real>

$FrTrjPar \rightarrow FrMaxAccSetPnt$ - Maximum force acceleration setpoint, <REAL>

This input sets the maximum allowable acceleration of the force, effectively shaping the force trajectory. It's measured in the same units as TgtFr, but on a per second squared basis, underscoring its role in adjusting the system's dynamics to match particular requirements. Importantly, the force rate, measured in N/s, represents the first derivative of force, indicating how quickly the force changes over time. Meanwhile, force acceleration, denoted in N/s^2 , is the second derivative of force, reflecting the rate of change of the force rate itself. FrMaxAccSetPnt is crucial in managing how rapidly the hydraulic cylinder's force accelerates, facilitating a controlled and precise progression towards the target force.

FrTrjPar → FrJerkSetPnt - Maximum force jerk setpoint, <REAL>

This parameter modulates the transition dynamics of force application, dictating the rapidity or gradualness by controlling the rate at which force acceleration changes. Expressed in the same units as *TgtFr* but per cubic second, adjusting the *FrJerkSetPnt* enables users to finely tune the force trajectory to achieve the preferred level of abruptness or smoothness in force adjustments. This flexibility allows for precise control over the force application, ensuring both responsiveness and smooth operation. See figure 10.



FrCntrlPar		
	SwitchPos2Fr	<real></real>
	KpFr	<real></real>
	МахКрАтр	<real></real>
	KiFr	<real></real>
	ModeIntCntrl	<bool></bool>
	FrGainFwdSpdCtrl	<real></real>
	FrGainBwdSpdCtrl	<real></real>

$FrCntrlPar \rightarrow SwitchPos2Fr$ - Change from position to force controll, <REAL>

Refer to the description of input Mode. See figure 6: Between T=0.0 and T=1.24s, ActFr < SwitchPos2Fr. So the function block is in position control. After T=1.24s, ActFr > SwitchPos2Fr so the function block switches automatically to force control.

$FrCntrlPar \rightarrow KpFr$ - Force controller P-Factor, <REAL>

This input represents the amplification factor of the P-controller within the force controller. A higher *KpFr* value can enhance control accuracy. However, caution is advised: setting the *KpFr* value excessively high may render the closed-loop system unstable. For optimal results and to maintain system stability, it's recommended to initiate with a modest value and incrementally adjust upwards to achieve the desired precision. See example 2 for optimal adjustment.

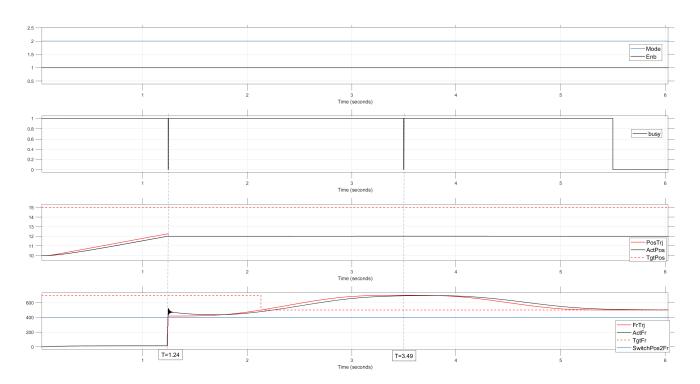


Figure 6: Switch from position to force control mode



FrCntrlPar o MaxKpAmp - Maximum Kp Amplification, <REAL>

It relates to the P-controller (Force controller) within the function block, which is capable of dynamically altering the constant KpFr factor. This adjustment ensures that the hydraulic cylinder exhibits consistent control behavior regardless of the load it bears. The dynamic value of the KpFr factors is calculated based on the pressure on the piston side of the cylinder. If the cylinder lacks a pressure sensor, the controller operates with a constant Kp value (in this case set ActPr to -1). Through the MaxKpAmp input, users can set the upper limit of the amplification for this constant Kp value. We recommend setting it between 4 and 5.

Important: If the hydraulic cylinder's pressure is not being measured, enter a default value of -1 in the *ActPr* input. This action will effectively deactivate the pressure-dependent dynamic calculation of KpFr.

$FrCntrlPar \rightarrow KiFr$ - Force controller I-Factor, $\langle REAL \rangle$

This input represents the amplification factor of the P-controller within the force controller. A higher *KiFr* value can enhance control accuracy. However, caution is advised: setting the *KiFr* value excessively high may render the closed-loop system unstable. For optimal results and to maintain system stability, it's recommended to initiate with a modest value and incrementally adjust upwards to achieve the desired precision. See example 2 for optimal adjustment.

FrCntrlPar o ModeIntCntrl - Mode Selection for internal Integral Controller, <BOOL>

This input determines the behavior of the I-Controller. When set to False, the I-Controller remains continuously active. If set to True, the I-Controller operates only in the steady state, deactivating during the hydraulic axis movement. We advise setting this input to true, as allowing the I-Controller to function solely in the steady state often provides superior stability and accuracy for hydraulic axes. This approach typically minimizes, if not eliminates, significant overshoots and, by enabling an increase in the *KiFr* factor, greatly enhances accuracy.

FrCntrlPar → FrGainFwdSpdCtrl - Force Positive Speed Feedforward, <REAL>

It serves as a feedforward control factor during force control. This factor introduces a static component into the control signal during the build-up of force. It enhances the responsiveness and accuracy of the force control process. See example 2 for optimal adjustment.

FrCntrlPar → FrGainBwdSpdCtrl - Force Positive Speed Feedforward, <REAL>

It serves as a feedforward control factor during force control. This factor introduces a static component into the control signal during the reduction of force. It enhances the responsiveness and accuracy of the force control process. See example 2 for optimal adjustment.

Enb - Turn controller on/off, <BOOL>

This input controls the activation or deactivation of the function. When the input signal is turned off (False), the function no longer responds to changes in the setpoints and does not generate any trajectory. The monitoring signal *PosTrj* reflects the current position and *FrTrj* reflects the current force, while the other monitoring signals are set to zero. In addition, when the function is deactivated, the *CtrlOut* is set to zero, indicating that there is no valve movement caused by the controller, as shown in table 1.



	CtrlOut	PosTrj	SpdTrj	AccTrj	FrTrj	FrRateTrj	FrAccTrj
Enb =True Mode =1	calculated based on the po- sition control algorithm	calculated by posi- tion trajectory generator	calculated by speed trajectory generator	calculated by accel- eration trajectory generator	reflects the cur- rent force	0	0
Enb =True Mode =2 ActFr < SwitchPos2Fr	calculated based on the po- sition control algorithm	calculated by posi- tion trajectory generator	calculated by speed trajectory generator	calculated by accel- eration trajectory generator	reflects the cur- rent force	0	0
Enb =True Mode =2 ActFr > SwitchPos2Fr	calculated based on the force control algorithm	reflects current position	0	0	calculated by force trajectory generator	calculated by force trajectory generator	calculated by force trajectory generator
Enb =False	0 + Offset	reflects current position	0	0	reflects the cur- rent force	0	0

Table 1: Output signals with the different modes of the controller

Mode - Mode select input, <INT>

The function block can operate in either position control or force control mode, depending on the *Mode* input setting. This versatility allows the block to adapt its behavior to meet specific application requirements.

<u>Mode=1:</u> In this mode, the function block operates in position control. There is no monitoring of force values; the system focuses solely on achieving and maintaining the target position.

<u>Mode=2:</u> Initially, the function block operates in position control mode, similar to Mode 1. However, in Mode 2, the current force value at the *ActFr* input is continuously monitored. If the actual force exceeds the threshold specified by the *SwitchPos2Fr* input, the function block automatically switches from position control to force control. This transition ensures that the system can adapt to changing load conditions without manual intervention as shown in table 1.

Important Notes:

In Mode 1, there is no force monitoring. The system does not react to changes in force; it remains dedicated to position control regardless of any force applied.

In Mode 2, the switch from position to force control occurs only once when the actual force surpasses the *SwitchPos2Fr* threshold. It's crucial to understand that if the actual force falls below the *SwitchPos2Fr* threshold after switching to force control, the function block does not revert back to position control. This behavior is designed to maintain stability and prevent constant switching between modes under fluctuating force conditions.



TgtPos - Position setpoint, <REAL>

The input allows users to specify the desired target position for the hydraulic cylinder. It can be defined in any unit appropriate for the application (e.g., meters, centimeters, millimeters, micrometer). When *TgtPos* recognizes a change, the function generates a trajectory from the current position to the specified target. The internal position controller ensures that the cylinder follows this trajectory accurately.

Important: It's essential to understand that any changes to the *TgtPos*, *MaxSpdSetPnt*, *MaxAccSetPnt* and *JerkSetPnt* during axis movement are internally ignored by the block. The block responds to changes only when *PosTrj* matches *TgtPos*. The *Busy* output serves as an indicator of the block's readiness: When the *Busy* output of the block is logically True, it indicates that the cylinder is in motion, and the controller will not respond to new setpoints. Conversely, if it is logically False, the cylinder is in a steady state, allowing the controller to react to new setpoints. See figure 7.

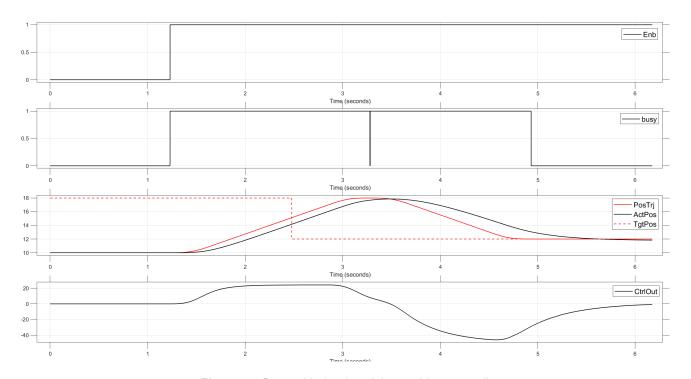


Figure 7: General behavior of the position controller

MaxSpdSetPnt - Maximum speed setpoint, <REAL>

This input sets the maximum speed allowed for the position trajectory generated by the internal generator. It is defined in the same unit as the *TgtPos* input, per second. This parameter ensures that the hydraulic cylinder moves at a controlled speed while reaching the target position defined by *TgtPos*. This sets the top speed for the hydraulic axis during movement. However, factors like distance, acceleration *MaxAccSetPnt*, and jerk *JerkSetPnt* might make it go slower than this speed. See figure 8.



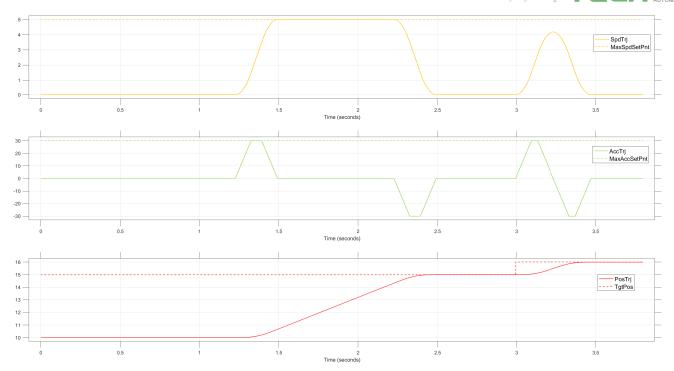


Figure 8: General behavior of the input MaxSpdSetPnt

TgtFr - Target Force setpoint, <REAL>

The input allows users to specify the desired target force for the hydraulic cylinder. It can be defined in any unit appropriate for the application (e.g., N, kN, MN). When *TgtFr* recognizes a change and the function is in force control mode, the function generates a trajectory from the current force to the specified target. The internal controller ensures that the current force follows this trajectory accurately. When the function block is deactivated, changes to this input is without function.

Important: It is essential to understand that any changes to the TgtFr, FrMaxSpdSetPnt, FrMaxAccSetPnt and FrJerkSetPnt during force adjusment are internally ignored by the block. The block responds to changes only when FrTrj matches TgtFr. The Busy output serves as an indicator of the block's readiness: When the Busy output of the block is logically True, it indicates that the cylinder force is in transition, and the controller will not respond to new setpoints. Conversely, if it is logically False, the cylinder is in a steady state, allowing the controller to react to new setpoints. See figure 9: at T=3.23s, FrTrj exactly equals FrTrj=700N. Exactly at this time point the Busy output set to false and the FrTrj goes to the new target TgtFr=500N.



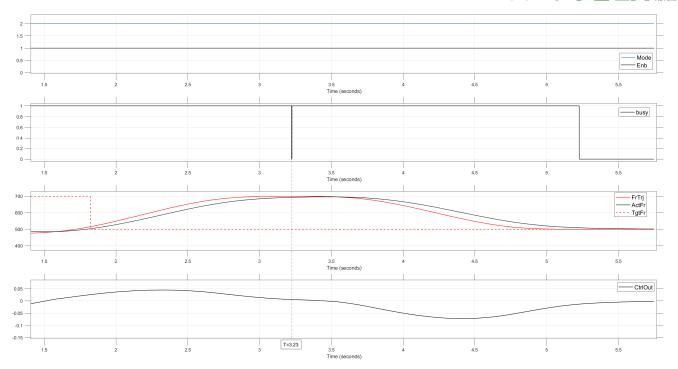


Figure 9: Reaction of the controller with a new setpoint while moving.

FrMaxSpdSetPnt - Maximum force rate setpoint, <REAL>

This parameter defines the maximum rate at which the force can change, as determined by the internal trajectory generator, and is measured in the same units per second as the *TgtFr* input. It governs the pace at which the hydraulic axis approaches the designated target force, ensuring a smooth and controlled force adjustment. Although this setting establishes the upper limit of the force change rate, the actual rate may be influenced by additional factors such as the total force adjustment required, *FrMaxAccSetPnt*, and *FrJerk-SetPnt*, potentially resulting in a slower adjustment than the maximum specified rate.

Offset - Displacement of ControlSignal, <REAL>

This input serves as a means of adjusting the control signal in both the activated and deactivated states of the controller. When the controller is enabled, the value is added to the control signal, allowing for an additional offset. This enables manual control of the cylinder's position in conjunction with the controller's output. In the deactivated state, where the controller output is fixed at zero, the input can be used as a direct means of manual control, independently influencing the cylinder's behavior. It provides a convenient way to switch between automatic and manual operation of the cylinder.



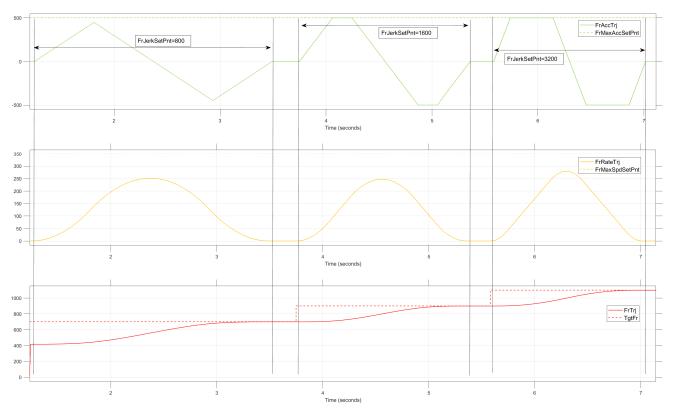


Figure 10: General behavior of the input FrJerkSetPnt

Outputs

CtrlOut - Control Signal, <REAL>

This is the primary output of the block, indicating the valve's opening value. When confined within the range of -100 and +100, this value denotes the valve's opening percentage in one or another direction. It is essential to map this percentage to the valve's physical input, which may be quantified in terms of current or voltage. See figure 3 and figure 4.

PosTrj - Monitoring Signal: Position Trajectory, <REAL>

The *PosTrj* output provides information about the desired position trajectory that the hydraulic cylinder should follow. It represents the path from the current position (*ActPos*) to the target position (*TgtPos*). This output is mainly used for monitoring and visualization purposes, allowing users to observe the planned trajectory of the cylinder's movement.

Note: If the *Enb* input is set to false, the *PosTrj* will match the current position *ActPos* of the hydraulic axis. See table 1.

SpdTrj - Monitoring Signal: Speed Trajectory, <REAL>

The *SpdTrj* output represents the velocity trajectory which the hydraulic cylinder should follow. It starts and ends at zero and is limited by the *MaxSpdSetPnt* input. This output is primarily used for monitoring purposes. **Note:** If the *Enb* input is set to false, the *SpdTrj* will default to zero. See table 1.

AccTrj - Monitoring Signal: Acceleration Trajectory, <REAL>

The *AccTrj* output represents the velocity trajectory which the hydraulic cylinder should follow. It starts and ends at zero and is limited by the *MaxAccSetPnt* input. This output is primarily used for monitoring purposes. **Note:** If the *Enb* input is set to false, the *AccTrj* will default to zero. See table 1.



FrTrj - Monitoring Signal: Force Trajectory, <REAL>

It represents the force trajectory, a dynamic profile detailing the planned progression of force over time. This output is critical for visualizing and understanding how the force is intended to evolve throughout the operation, based on the current input parameters and desired end goal. This output is mainly used for monitoring and visualization purposes, allowing users to observe the planned trajectory of the force exerted by the hydraulic axis.

Note: If the *Enb* input is set to false, the *FrTrj* will match the current force *ActFr* of the hydraulic axis. See table 1.

FrRateTrj - Monitoring Signal: Force Rate Trajectory, <REAL>

It delineates the trajectory of the force rate, illustrating the speed at which the force is programmed to change over time within the force controller. It provides a clear representation of how rapidly or slowly the force is expected to evolve, aiding in the optimization of force control strategies for enhanced performance and responsiveness. It starts and ends at zero and is limited by the *FrMaxSpdSetPnt* input. This output is primarily used for monitoring purposes.

Note: If the *Enb* input is set to false, the *FrRateTrj* will default to zero. See table 1.

FrAccTrj - Monitoring Signal: Force Acceleration Trajectory, <REAL>

It indicates the force acceleration trajectory, providing a time-based profile of the expected acceleration rates of force. It starts and ends at zero and is limited by the *MaxAccSetPnt* input. This output is primarily used for monitoring purposes.

Note: If the *Enb* input is set to false, the *FrAccTrj* will default to zero. See table 1.

Busy - Monitoring Signal: Busy signal, <BOOL>

This output reflects the block's responsiveness to new setpoints. If the hydraulic cylinder is moving or under force transition, the <code>Busy</code> output becomes True , indicating that the block is not responding to changes in setpoints. The block resumes responsiveness when <code>PosTrj</code> aligns with <code>TgtPos</code> in position control or <code>FrTrj</code> aligns with <code>TgtFr</code> in force control, at which point the <code>Busy</code> output switches to False , signaling readiness to accept setpoint modifications. See figure 11.



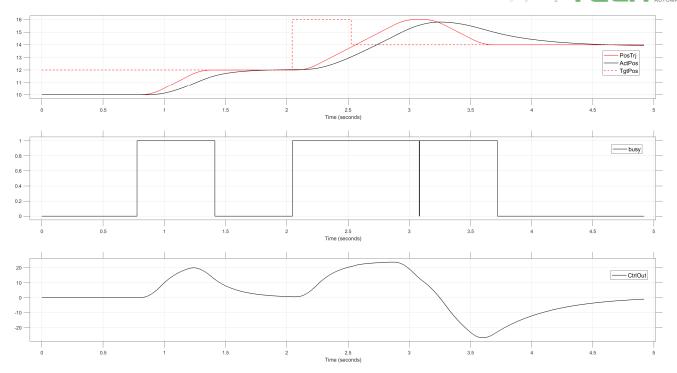


Figure 11: Reaction of output Busy while performing an movement

FAQ

How do I stop the hydraulic cylinder during its movement?

To halt the axis while it's moving, simply set the *Enb* Input to logical false. Doing this makes the *CtrlOut* immediately drop to zero, leading to the valve closing and consequently stopping the movement. For a more detailed description, see example 2.

Can I input a new position target while the axis is still in motion?

If you wish to assign a new target position (*TgtPos*) during the axis's operation, you must first halt the movement using the *Enb* input. After stopping, wait for a specific delay (a few tens to hundreds of milliseconds depending on the specific axis) to ensure the axis has fully settled. Once stationary, you can then input the new *TgtPos*.


How can I effectively adjust the parameter KpPos, KiPos, GainFwdSpdCtrl and GainBwdSpdCtrl?

For a detailed description, see example 1.

How can I effectively adjust the parameter KpFr , KiFr , FrGainFwdSpdCtrl and FrGainBwdSpdCtrl ? For a detailed description, see example 2.




Examples

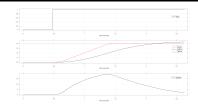

Example 1: Setting the position control and feedforward parameters

This example shows how you can adjust the position control and feed-forward parameters experimentaly.

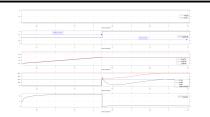

Example 2: Setting the force control and feedforward parameters

This example shows how you can adjust the force control and feed-forward parameters

Important for all examples: These values are provided solely as examples to illustrate the approach for setting control parameters. Under no circumstances should these values be directly applied to your machine, not even as initial starting points. The control parameters must be explicitly adjusted for each machine individually.



Setting the position control and feedforward parameters

Begin by initializing all parameters *KpPos*, *KiPos*, *GainFwdSpdCtrl* and *GainBwdSpdCtrl* to zero. Start the tuning process with the *KpPos* value by setting it to a minimal level. Then, specify a position target using the *TgtPos* and enable the controller. Ideally, adjust *KpPos* so that, during the movement the actual position runs parallel with the position trajectory output (*PosTrj*) at certain moments. If *KpPos* is too low, the actual position might never gets paralleled with the position trajectory.

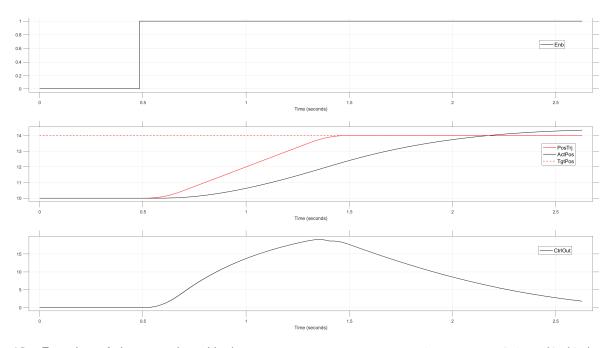


Figure 12: Reaction of the controler with the parameters $\mathit{KpPos} = 10$; $\mathit{KiPos} = 0$; $\mathit{GainFwdSpdCtrl} = 0$ and $\mathit{GainBwdSpdCtrl} = 0$.

In Figure 12, it is observable that during the movement, the *ActPos* and *PosTrj* are never parallel. This indicates that the *KpPos* value is too small.

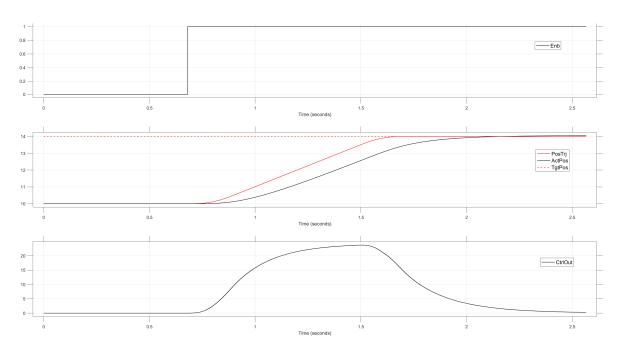


Figure 13: Reaction of the controler with the parameters KpPos = 25; KiPos = 0; GainFwdSpdCtrl = 0; GainBwdSpdCtrl = 0 and GainAccCtrl = 0.



AAccording Figure 13 when the *KpPos* increased to 25, the *PosTrj* and *ActPos* now run parallel during movement, indicating that the *KpPos* has been optimally adjusted for the current conditions.

Setting GainFwdSpdCtrl and GainBwdSpdCtrl: After setting the KpPos value, read the value of CtrlOut at any point where ActPos and PosTrj run parallel during movement and divide it by MaxSpdSetPnt. Enter the resulting value into the GainFwdSpdCtrl input. See figure 14.

$$\textit{GainFwdSpdCtrl} \ = \frac{\textit{CtrlOut}\ _{t=2.26s}}{\textit{MaxSpdSetPnt}\ _{t=2.26s}} = \frac{21.85}{5} = 4.37$$

Repeat the same process when retracting the cylinder, without changing the *KpPos* value. Divide *CtrlOut* by *MaxSpdSetPnt* and enter this result into the *GainBwdSpdCtrl* input. See figure 14.

$$\textit{GainBwdSpdCtrl} \ = \frac{\textit{CtrlOut}\ _{t=5.04s}}{\textit{MaxSpdSetPnt}\ _{t=5.04s}} = \frac{34.15}{5} = 6.83$$

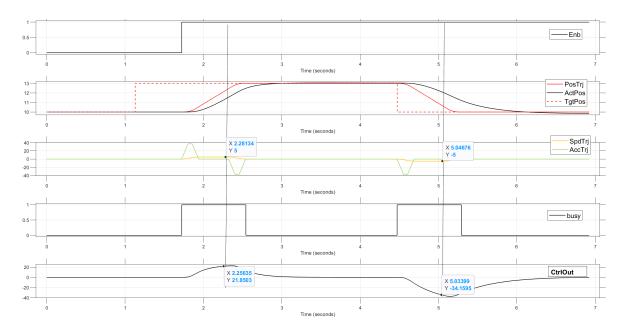


Figure 14: Adjusting the feedforward parameters based on the system's response to a control input.

SSetting *KiPos*: For setting *KiPos*, we suggest setting the *ModeIntCntrl* input to True, ensuring that the I-controller is active only in steady states. Then, observe the persistent control deviation of the position and incrementally increase *KiPos* until you are satisfied with the controller's accuracy.



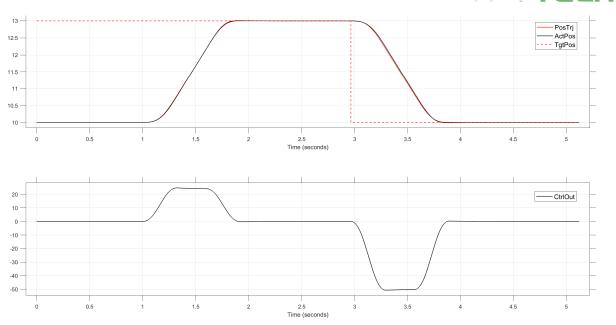


Figure 15: System behavior with well-adjusted parameters.

When all parameters are adjusted as described, the system should be able to closely follow the desired trajectory, as illustrated in Figure 15.

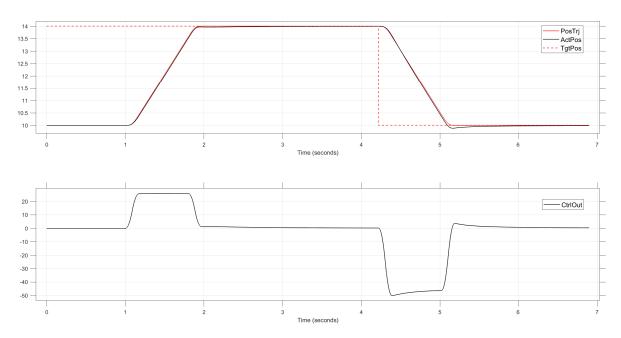


Figure 16: Overshoot despite proper parameter adjustment.

Note: If, despite proper parameter adjustment, overshooting is observed in the control behavior (as shown in figure 16), it is an indication that the dynamics of the Position Trajectory are faster than your machine's maximum capability. Therefore, you should reduce the *MaxAccSetPnt* and *JerkSetPnt* parameters.



Setting the force control and feedforward parameters

Begin by initializing all parameters *KpFr*, *FrGainFwdSpdCtrl*, *FrGainBwdSpdCtrl* and *KiFr* to zero. Start the tuning process with the *KpFr* value by setting it to a minimal level. Then, specify a force target using the *TgtFr* and enable the controller. Ideally, adjust *KpFr* so that, during the force transition the actual force runs parallel with the force trajectory output *FrTrj* at certain moments. If *KpFr* is too low, the actual force might never gets paralleled with the position trajectory. In figure 17 the value of *KpFr* is to low.

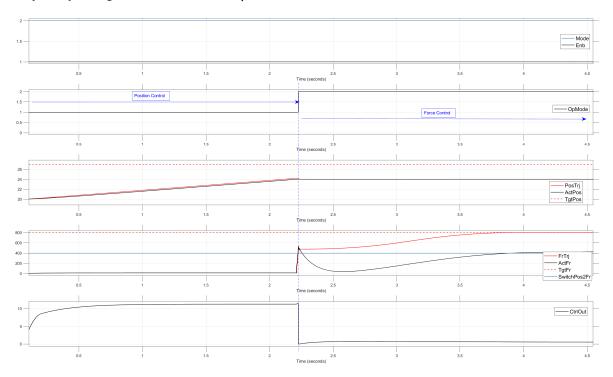


Figure 17: Reaction of the controller with the parameters KpFr = 0.002; KiFr = 0; FrGainFwdSpdCtrl = 0 and FrGainBwdSpdCtrl = 0.

A suitable value for *KpFr* is shown in figure 18.

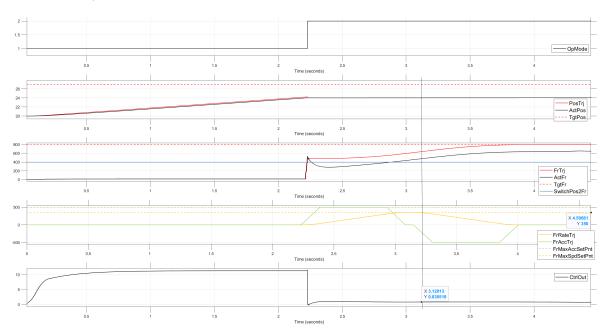


Figure 18: Reaction of the controller with the parameters KpFr = 0.007; KiFr = 0; FrGainFwdSpdCtrl = 0 and FrGainBwdSpdCtrl = 0.



Setting FrGainFwdSpdCtrl and FrGainBwdSpdCtrl: After setting the KpFr value, read the value of CtrlOut at any point where ActFr and FrTrj run parallel during force transition and divide it by FrMaxSpdSetPnt. Enter the resulting value into the GainFwdSpdCtrl input. Also shown in figure 18.

$$\textit{FrGainFwdSpdCtrl} \ = \frac{\textit{CtrlOut}\ _{t=3.12s}}{\textit{MaxSpdSetPnt}\ _{t=3.12s}} = \frac{0.83}{350} = 0.0023$$

Repeat the same process when reducing the force, without changing the *KpFr* value. Divide *CtrlOut* by *Fr-MaxSpdSetPnt* and enter this result into the *FrGainBwdSpdCtrl* input. After setting *FrGainFwdSpdCtrl* and *FrGainB-wdSpdCtrl* the force control behavior should be much better, as seen in figure 19.

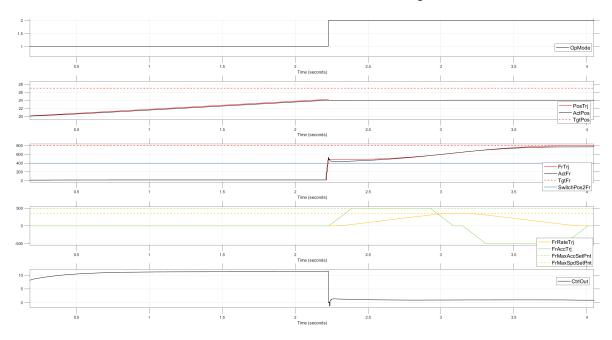


Figure 19: Reaction of the controller with the parameters KpFr = 0.007; KiFr = 0; FrGainFwdSpdCtrl = 0.0023 and FrGainBwdSpdCtrl = 0.0023.

Setting *KiFr*: For setting *KiFr*, we suggest setting the *ModeIntCntrl* input to one, ensuring that the I-controller is active only in steady states. Then, observe the persistent control deviation of the force and incrementally increase *KiFr* until you are satisfied with the controller's accuracy.



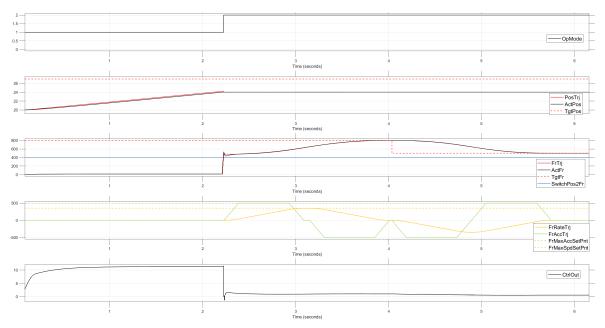


Figure 20: Reaction of the controller with the parameters KpFr = 0.007; KiFr = 0.5; FrGainFwdSpdCtrl = 0.0023 and FrGainBwdSpdCtrl = 0.0023.

When all parameters are adjusted as described, the system should be able to closely follow the desired force trajectory, as illustrated in figure 20.